


[To the customer who uses USTREAM (IBM Cloud Video) function]

In accordance with the security update of USTREAM (IBM Cloud Video), the screen below would be indicated at the connection.

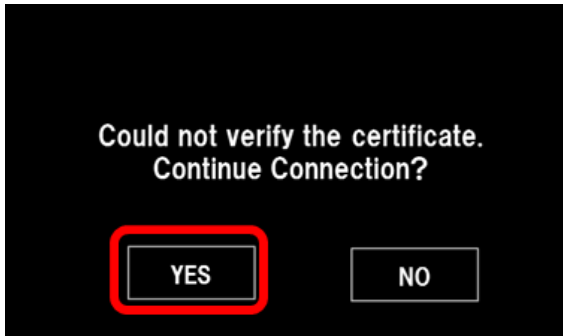

This would happen since the communication which uses TLS (Transport Layer Security) version 1.0 or 1.1 is interrupted by the USTREAM side.

Therefore, the verification of the certificate cannot be performed in the unit, and “certificate verification error” would be indicated on “USTREAM authentication” and “Transmission control panel” of USTREAM every time. (It would take about 30 seconds until the screen is indicated.)

The streaming can be carried out by pressing “YES” after the error happens, however, it is possible to access to the unintended server depending on the environment to use since the other end of the connection cannot be confirmed. When using this function, be sure to confirm if the network is secured.

Additionally, the communication with the server is encrypted even though the certification of the server is omitted.

The applicable models of this symptom are as below.

- PXW-X70 V3.00, 3.01, and 3.02
- HXR-NX5R V1.00, 1.01, and 1.10
- MCX-500 V1.00, 1.01, and 2.00
- HXR-NX80 V1.00
- PXW-Z90 V1.00

The corrected software will be provided one by one.

The corrected software for HXR-NX5R has been released as V1.11.

Note: The CN destination model is not applicable for the symptom since the function cannot be used in China.